
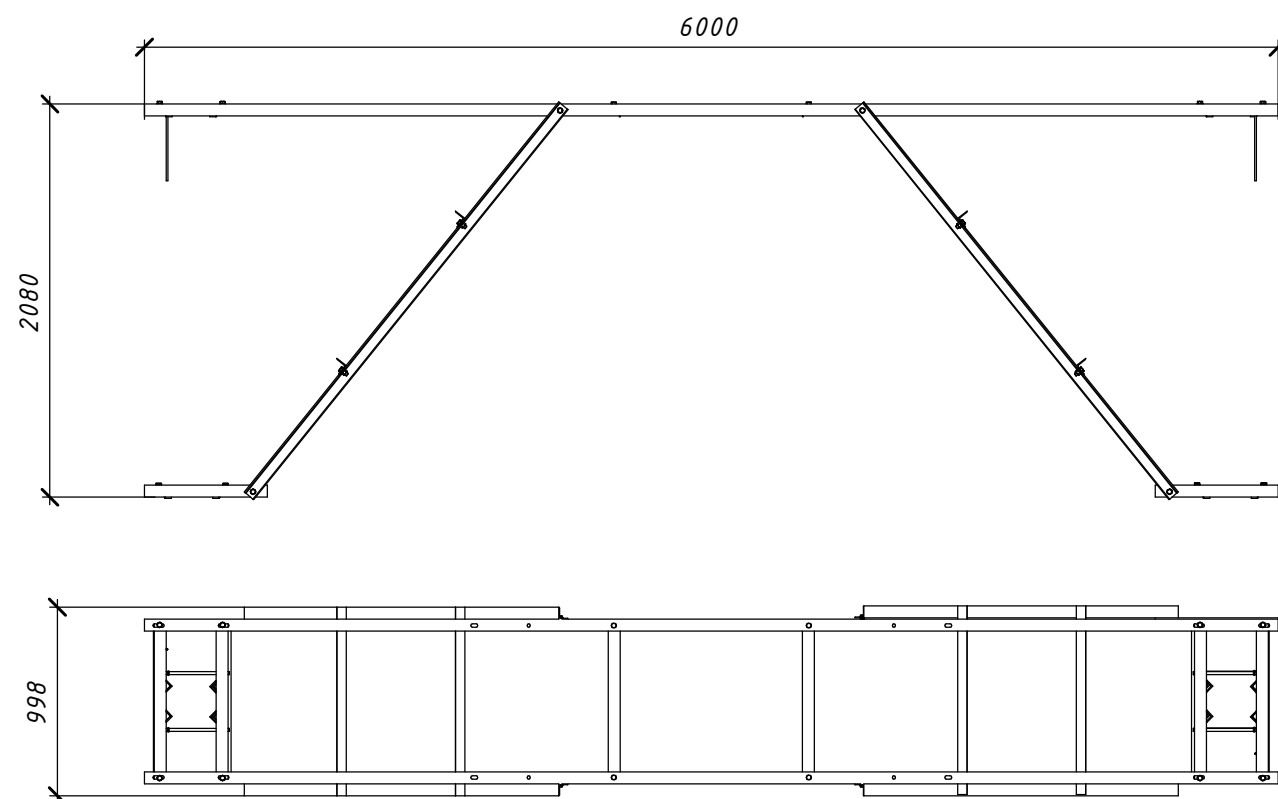


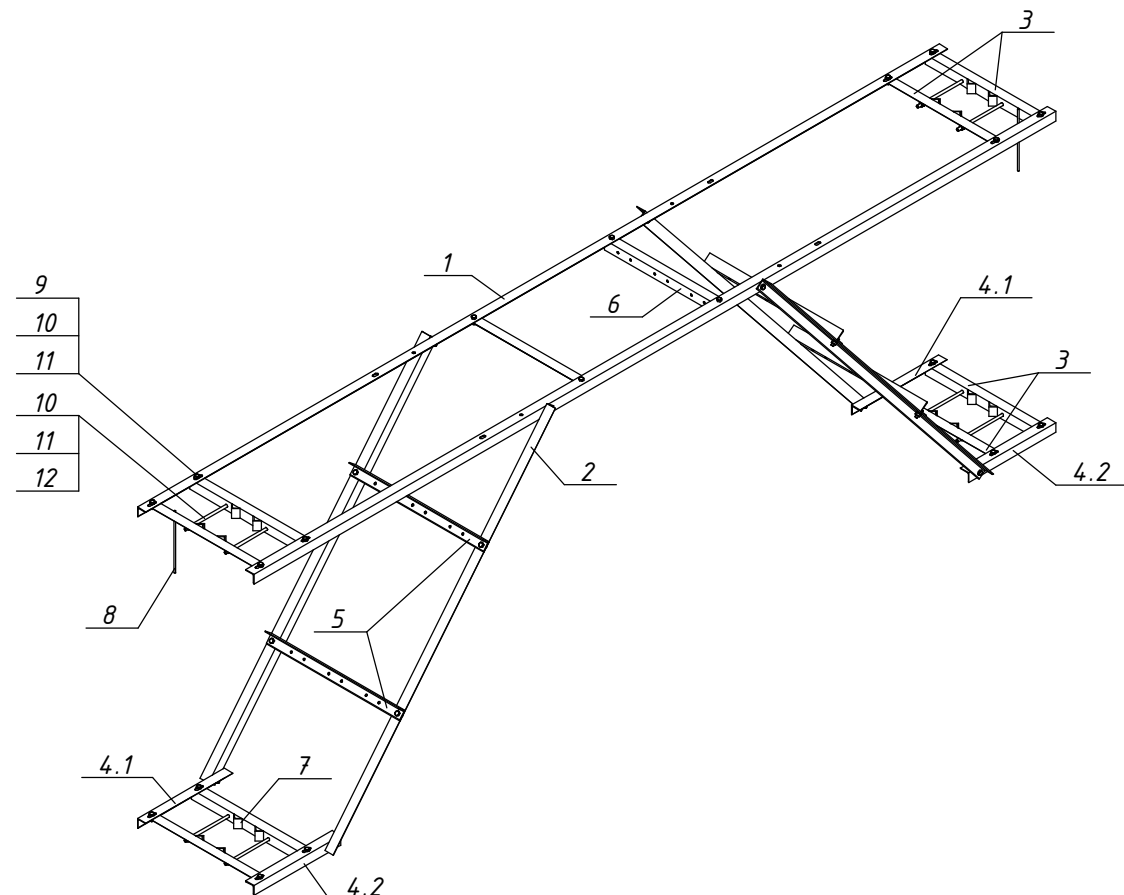


Зварні шви варити електродом Е42 ГОСТ 9467-75, Висота шва 5 мм.


Поз.	Позначення	Найменування	Кільк.	Маса од., кг.	Примітка
Деталі:					
1		Кутик $\frac{63 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=6000	2	28	
2		Кутик $\frac{63 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=2650	4	12,45	
3		Кутик $\frac{63 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=852	8	3,97	
4.1		Кутик $\frac{63 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=650	2	2,98	
4.2		Кутик $\frac{63 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=650	2	2,98	
5		Кутик $\frac{63 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=998	4	4,65	
6		Кутик $\frac{63 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=846	2	3,94	
7		Кутик $\frac{45 \times 5 \text{ ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=63	16	0,2	
8		Круг $\frac{\varnothing 16 \text{ С245 ДСТУ2251-93}}{\text{С245 ГОСТ27772-88}}$ L=400	2	0,25	
Стандартні вироби:					
7		Болт М16х40 ГОСТ 7798-70	36	0,11	
8		Гайка М16 ГОСТ 5915-70	52	0,04	
9		Шайба 16 Гост 6958-78	76	0,01	
10		Шпилька М16х380 ГОСТ 22042-76	8	0,58	

Зам. інв. №	
Підпис і дата	
Інв. № орг.	


Поз. 1
(1:40)

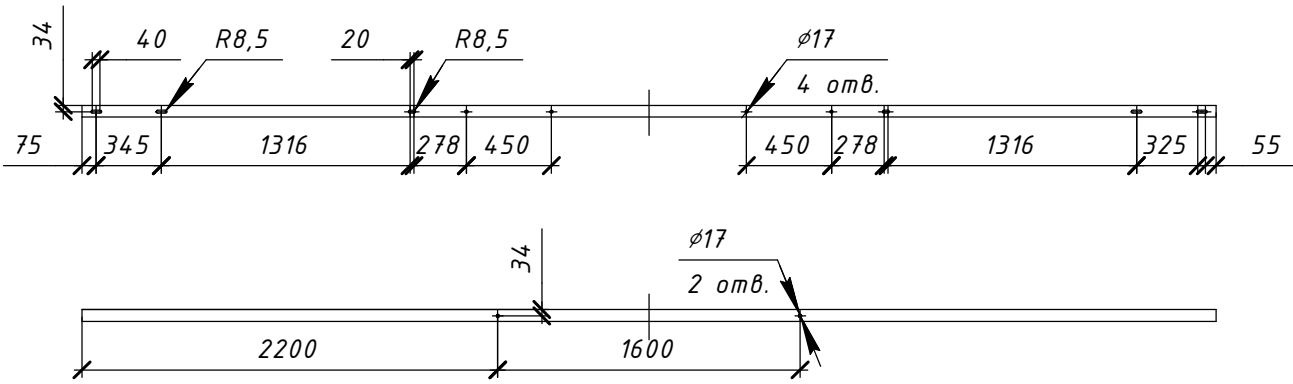


Поз. 2
(1:20)

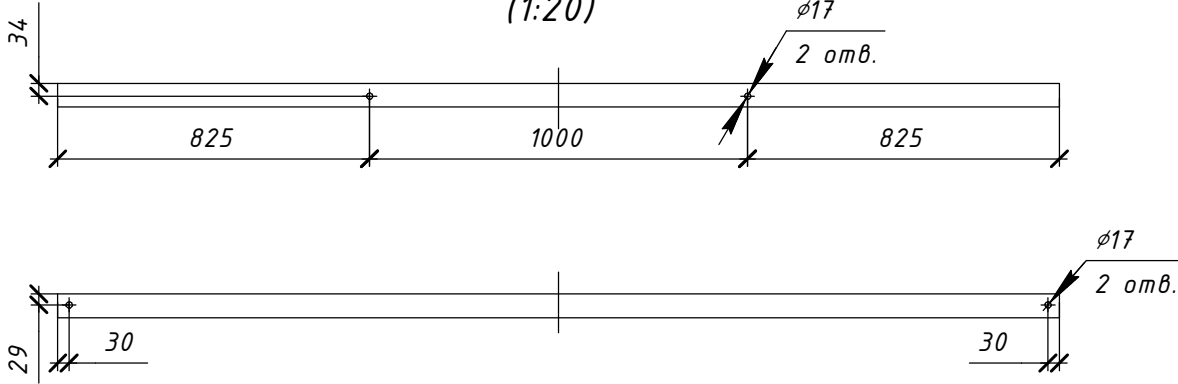


Поз. 3
(1:20)

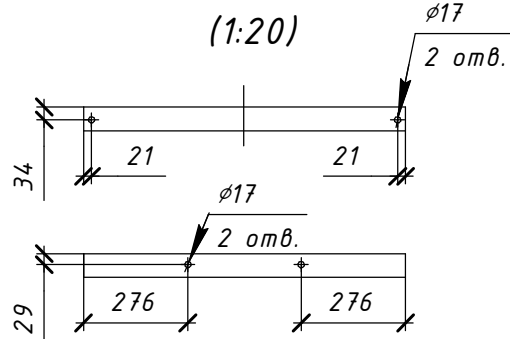


Поз. 4.1
(1:20)

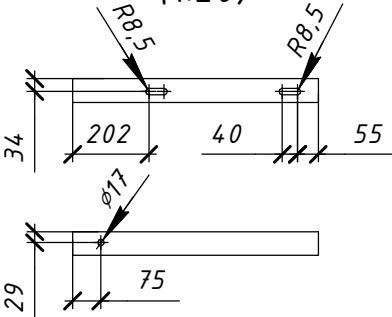


Поз. 4.2
(1:20)

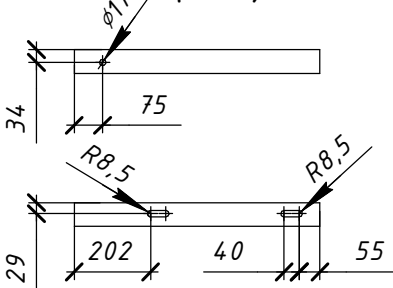

Поз. 5
(1:20)

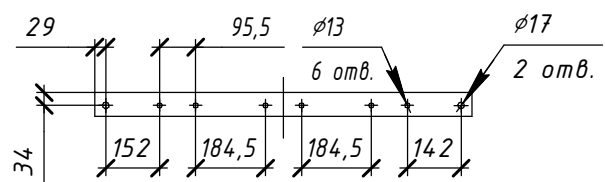

Поз. 6
(1:20)

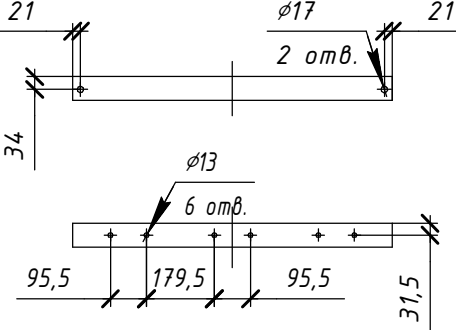

Поз. 3 та Поз. 7
(1:20)

